


SR

maxell

Silver Oxide Battery

SR44W / SR43W / SR1130W / SR1120W / SR936W / SR927W / SR920W / SR41W / SR726W / SR721W / SR626W / SR621W / SR44SW / SR43SW / SR1136SW / SR1130SW / SR1120SW / SR1116SW / SR936SW / SR927SW / SR920SW / SR916SW / SR914SW / SR41SW / SR731SW / SR726SW / SR721SW / SR716SW / SR712SW / SR626SW / SR621SW / SR616SW / SR527SW / SR521SW / SR516SW / SR512SW / SR421SW / SR416SW / SR44 / SR43 / SR1130 / SR1120 / SR41 / 4SR44

SILVER OXIDE BATTERY

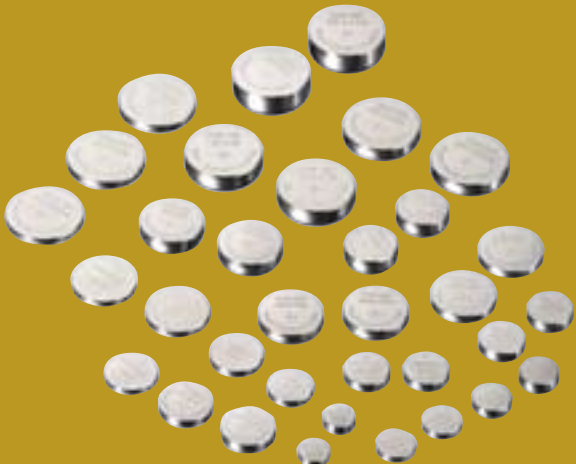

Safety Instructions

Improper handling of the battery could lead to distortion, leakage*, overheating, or explosion, causing bodily injury or equipment trouble. Especially touch with liquid leaked out of battery could cause injury like a loss of eyesight. Please observe the following instructions to prevent accidents.

(* Leakage is defined as the unintentional escape of a liquid from a battery.)

Warnings Handling

■ **Never swallow.**

Always keep the battery out of the reach of infants and young children to prevent it from being swallowed. If it is swallowed, consult a physician immediately.

■ **Never allow liquid leaking from the battery to get in your body.**

The battery contains strong alkaline liquid, which is deleterious material. If it does come in contact with your eyes, flush them immediately with plenty of water and consult a physician, because the alkaline liquid could cause becoming blind. Likewise, If the liquid gets in your mouth, rinse immediately with plenty of water and consult a physician. The alkaline liquid could also cause the skin irritation and/or chemical burns. If the liquid adheres to the skin or clothes, immediately flush it with plenty of water.

■ **Never short-circuit the battery.**

Do not allow the positive and negative terminals to short-circuit. Never carry or store the battery with metal objects such as a necklace or a hairpin. Do not take multiple batteries out of the package and pile or mix them when storing. Otherwise, this could lead to distortion, leakage, overheating, and explosion of the battery.

■ **Never charge.**

The battery is not designed to be charged by any other electrical source. Charging could generate gas and internal short-circuiting, leading to distortion, leakage, overheating, or explosion.

■ **Never expose to open flames.**

Exposing to flames could cause explosion of the battery.

■ **Never heat.**

Heating the battery to more than 100 deg. C could increase the internal pressure, causing distortion, leakage, overheating, or explosion.

■ **Never disassemble or deform the battery.**

Disassembly or deforming of the battery could cause the leakage, overheating, or explosion due to an internal short-circuits.

Caution Handling/Storage

■ **Never reverse the positive and negative terminals when mounting.**

Improper mounting of the battery may lead to short-circuiting, charging or forced-discharging. This may cause distortion, leakage, overheating, or explosion.

■ **Never short-circuit the battery while installing into equipment.**

Please be careful when installing the battery not to short-circuit it with metal portions of the equipment.

■ **Never weld the terminal or wire to the body of the battery directly.**

The heat of welding or soldering may cause distortion, leakage, overheating, or explosion of the battery.

■ **Never use different batteries together.**

Using different batteries together, i.e. different type or used and new or different manufacturer may cause distortion, leakage, overheating, or explosion because of the differences in battery property.

■ **Never leave the used battery in equipment.**

Long time leaving in the equipment may generate gas leading to distortion, leakage, overheating, or explosion and the equipment may be damaged.

■ **Remove the battery from equipment while not in use for a long time**

Gas may be generated in the battery leading to leaking and damaging of the equipment.

■ **Never subject the battery to severe shock.**

Dropping, or throwing or stomping on the battery may cause distortion, leakage, overheating, or explosion.

■ **Use the correct battery suitable for the equipment.**

The battery may not be suitable for the specific equipment due to the using conditions or type of equipment. Please select the suitable battery according to the handling instructions of the equipment.

■ **Never use or leave the battery in a hot place such as under the direct rays of the sun or in a car in hot weather.**

If you do, this may cause distortion, leakage, overheating, and explosion of the battery.

■ **Never store the battery in a hot and highly humid environment.**



Doing so may cause the performance of the battery to deteriorate. In certain environments, this may lead to distortion, leakage, overheating, and explosion of the battery.

■ **Never allow the battery to come in contact with water.**

If it does, this may cause the battery to rust or lead to distortion, leakage, overheating, and explosion.

Caution Disposal

The battery may be regulated by national or local regulation. Please follow the instructions of proper regulation. As electric capacity is left in a discarded battery and it comes into contact with other metals, it may lead to distortion, leakage, overheating, or explosion, so make sure to cover the (+) and (-) terminals with friction tape or some other insulator before disposal.

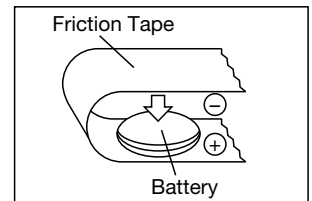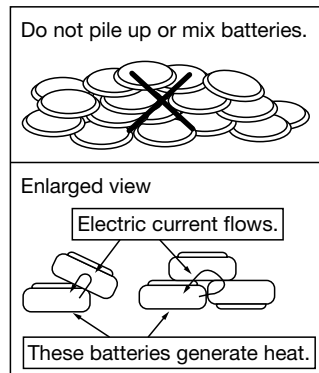

Example of battery insulation

Overview

Maxell is the first company in Japan to successfully market button-type silver oxide batteries. Based on many years of experience and know-how in various fields, the SR battery is suitable for precision electronic devices such as quartz watches, where high-energy density per unit volume and a stable operating voltage are required. Various product lineups are available to meet the growing need for supplying power to various types of watches, ranging from large to compact, thin models.

Zero-mercury, zero-lead added types are also available. For more information, please contact Maxell.

Products

High drain type													
Model	SR44W	SR43W	SR1130WS	SR1120W	SR936W	SR927W	SR920W	SR41W	SR726W	SR721W	SR626W	SR621W	
Nominal Voltage (V)	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	
Nominal Capacity (mAh)*	165	125	79	55	75	60 57	39	39	28	25	28	18	
Nominal Discharge Current (μA)	200	200	100	100	100	100	100	50	50	50	50	50	
Dimensions	Diameter (mm)	11.6	11.6	11.6	11.6	9.5	9.5	9.5	7.9	7.9	7.9	6.8	6.8
	Height (mm)	5.4	4.2	3.05	2.05	3.6	2.73	2.05	3.6	2.6	2.1	2.6	2.15
Weight (g)	2.2	1.8	1.2	1.0	1.1	0.8	0.6	0.7	0.5	0.45	0.4	0.3	

Low drain type												
Model	SR44SW	SR43SW	SR1136SW	SR1130SW	SR1120SW	SR1116SW	SR936SW	SR927SW	SR920SW	SR916SW	SR914SW	SR41SW
Nominal Voltage (V)	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55
Nominal Capacity (mAh)*	165	110	100	83	55	29	71	55	45 39	26.5	22	45
Nominal Discharge Current (μA)	200	100	100	100	100	50	100	100	50	50	35	50
Dimensions	Diameter (mm)	11.6	11.6	11.6	11.6	11.6	9.5	9.5	9.5	9.5	9.5	7.9
	Height (mm)	5.4	4.2	3.6	3.05	2.05	1.65	3.6	2.73	2.05	1.65	1.45
Weight (g)	2.2	1.7	1.6	1.2	1.0	0.7	1.1	0.8	0.7 0.6	0.5	0.45	0.7


Low drain type													
Model	SR731SW	SR726SW	SR721SW	SR716SW	SR712SW	SR626SW	SR621SW	SR616SW	SR527SW	SR521SW	SR516SW	SR512SW	
Nominal Voltage (V)	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	1.55	
Nominal Capacity (mAh)*	36	33	25	23 22	10	30 28	23 18	16 15	17	16 14	11.5	5.5	
Nominal Discharge Current (μA)	50	50	30	30	20	30	30	20	30	20	20	5	
Dimensions	Diameter (mm)	7.9	7.9	7.9	7.9	7.9	6.8	6.8	6.8	5.8	5.8	5.8	5.8
	Height (mm)	3.1	2.6	2.1	1.68	1.29	2.6	2.15	1.65	2.7	2.15	1.65	1.25
Weight (g)	0.7	0.5	0.45	0.3	0.25	0.4	0.3	0.3	0.3	0.3	0.2	0.14	

Low drain type			General type						
Model	SR421SW	SR416SW	SR44	SR43	SR1130	SR1120	SR41	4SR44	
Nominal Voltage (V)	1.55	1.55	1.55	1.55	1.55	1.55	1.55	6.2	
Nominal Capacity (mAh)*	12	8	165	125	79	55	39	160	
Nominal Discharge Current (μA)	20	10	200	100	100	100	50	200	
Dimensions	Diameter (mm)	4.8	4.8	11.6	11.6	11.6	11.6	7.9	13
	Height (mm)	2.15	1.65	5.4	4.2	3.05	2.05	3.6	25.2
Weight (g)	0.17	0.12	2.2	1.8	1.2	1.0	0.7	11.7	

* Nominal capacity indicates the duration until the voltage drops to 1.2V when discharged at a nominal discharge current at 20 deg. C.

* Data and dimensions are reference values only. For further details, please contact your nearest Maxell office.



Construction

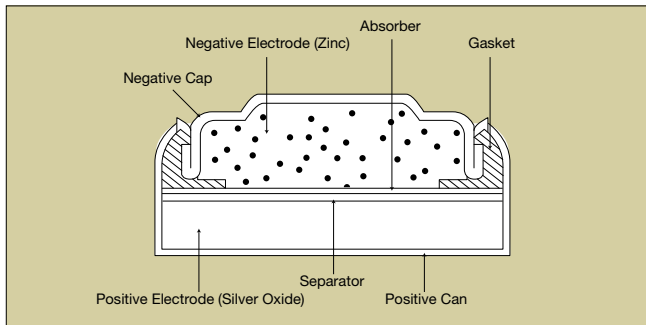

Principle and Reactions

The button-type silver oxide battery uses silver oxide (Ag_2O) as its positive active material and zinc (Zn) as its negative active material. Potassium hydroxide (KOH) (W-type) or sodium hydroxide (NaOH) (SW-type) is used as an electrolyte.

Battery Reactions



Features

Flat discharge characteristics

A flat discharge curve during discharge supplies a stable voltage until the end of the discharge life.

High-energy density

High-energy density per unit volume provides approx. twice as the amount of energy capacity as button-type alkaline batteries.

Excellent discharge load characteristics

Employing an alkaline electrolyte, the SR battery features excellent discharge load characteristics. Depending on the composition of the electrolytes, two models are available; (1) a

low-drain type for analog watches, and (2) a high-drain type for multi-function watches incorporating an alarm, illumination light, etc.

Superior leakage* resistance

Featuring Maxell's original leak-resistant processing, the SR battery has excellent leakage resistance, which suppresses the electrolyte from rising up and seeping out — a basic phenomenon of alkaline electrolytes.

(* Leakage is defined as an unintended escape of liquid from a battery.)

Applications

- Calculators
- Film Cameras
- Watches
- Medical Instruments, Cash Registers
- FA Instruments (Measuring Instruments, Onboard Microcomputers, Sensors)



Hitachi Maxell, Ltd.
2-18-2, Iidabashi,
Chiyoda-ku, Tokyo
102-8521 Japan
Tel: (+81) 3-3515-8249
Fax: (+81) 3-3515-8305

Visit our website at: www.maxell.com

NORTH AMERICA / SOUTH AMERICA

Maxell Corporation of America

Main Office:

22-08, Route 208 Fair Lawn, NJ
07410, U.S.A.
Tel: (+1) 201-794-5900
Fax: (+1) 201-796-8790

Canada Branch:

50 Locke Street, Unit #2, Concord,
Ontario L4K 5R4, Canada
Tel: (+1) 905-669-8107
Fax: (+1) 905-669-8108
E-mail: support@maxellcanada.com

Maxell Latin America

Plaza Btresh - Calle 50, Panama City,
Panama
Tel: (+507) 269-6737
Fax: (+507) 263-4413
E-mail: maxell@ciabtresh.com

EUROPE

Maxell Europe Ltd.

European Headquarters:

Multimedia House, High Street,
Rickmansworth, Hertfordshire,
WD3 1HR, United Kingdom
Tel: (+44) 1923 33 1000
Fax: (+44) 1923 33 1010
E-mail: hq@maxell.eu.com

UK Sales Office:

Multimedia House, High Street,
Rickmansworth, Hertfordshire,
WD3 1HR, United Kingdom
Tel: (+44) 1923 49 4400
Fax: (+44) 1923 49 4410
E-mail: sales@maxell.eu.com

Maxell Deutschland GmbH

Mollsfeld 2, 40670 Meerbusch,
Germany
Tel: (+49) 2159-913-0
Fax: (+49) 2159-913-150
E-mail: mdg@maxell.eu.com

Maxell (France) S.A.

BP 97091 Saint Ouen L'Aumone,
95 052 Cergy-Pontoise Cedex, France
Tel: (+33) 1 34 24 88 11
Fax: (+33) 1 30 73 56 77
E-mail: mfr@maxell.fr

Maxell Italia S.p.A.

Via Dante 2, 21100 Varese, Italy
Tel: (+39) 0332-240-934
Fax: (+39) 0332-240-950
E-mail: info@maxell-italia.it

Maxell Hungary Kft.

H-1097 Budapest, Mariassy utca 7,
Hungary
Tel: (+36) 1 464 3800
Fax: (+36) 1 464 3801
E-mail: mhu@maxell.eu.com

ASIA

Maxell Asia, Ltd.

Main Office:

506, World Commerce Centre,
Harbour City, Phase 1,
Canton Road, Kowloon,
Hong Kong
Tel: (+852) 2730 9243
Fax: (+852) 2735 6250
E-mail: maxell@maxell.com.hk

Vietnam Office:

Suite 15, Mezzanine Floor,
Sun Wah Tower, 115 Nguyen Hue
Boulevard, District 1,
Ho Chi Minh City, Vietnam
Tel: (+84) 8-821-9183
Fax: (+84) 8-821-9181
E-mail: maxellvn@saigonnet.vn

Maxell (Shanghai) Trading Co., Ltd.

Main Office:

PLAZA 336, Room No.1801, 18th Floor,
No.336, Xi Zang Middle Road, Huang Pu
District, Shanghai 200001, China
Tel: (+86) 21-3330-3377
Fax: (+86) 21-3330-4001
E-mail: maxell@maxell.net.cn

Beijing Office

Room 905, C Wantong Tower, No.6
Chaowai Road, Chaoyang District 100020,
Beijing, China
Tel: (+86) 10-5907-0016
Fax: (+86) 10-5907-0017
E-mail: maxellbj@public.bta.net.cn

Maxell Taiwan, Ltd.

14F, No.111, Sung Chiang Road,
Taipei, Taiwan
Tel: (+886) 2-2516-5553
Fax: (+886) 2-2516-4804
E-mail: maxell@maxell.com.tw

Maxell Asia (Singapore) Pte. Ltd.

Main Office:

10 Anson Road, #25-06,
International Plaza, Singapore 079903
Tel: (+65) 6220-9291
Fax: (+65) 6220-6070
E-mail: sales@maxell.com.sg

Chennai Office:

DBS Office Business Center, 31A,
Cathedral Garden Road, Near
Palmgrove Hotel, Chennai-600 034,
Tamil Nadu, India
Tel: (+91) 44-5264-9495
Fax: (+91) 44-5264-9495
E-mail: maxellchennai@touchtelindia.net